


Табела П42-12б.


Колутни куглични
једнореди лежај
Ознака 512
Ред мера 12

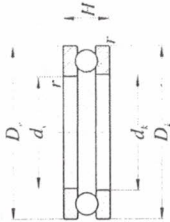

ozn. prov.	dv mm	dk mm	Dv mm	Dk mm	H mm	r mm	C kN	C0 kN
00	10	12	26	26	11	0,6	12,7	17
01	12	14	28	28	11	0,6	13,2	19
02	15	17	32	32	12	0,6	16,6	25
03	17	19	35	35	12	0,6	17,3	27,5
04	20	22	40	40	14	0,6	22,4	37,5
05	25	27	47	47	15	0,6	28	50
06	30	32	52	52	16	0,6	25,5	47,5
07	35	37	62	62	18	1,0	35,5	67
08	40	42	68	68	19	1,0	46,5	98
09	45	47	73	73	20	1,0	39	80
10	50	52	78	78	22	1,0	50	106
11	55	57	90	90	25	1,0	61	134
12	60	62	95	95	26	1,0	62	140
13	65	67	100	100	27	1,0	64	150
14	70	72	105	105	27	1,0	65,5	160
15	75	77	110	110	27	1,0	67	170
16	80	82	115	115	28	1,0	75	190
17	85	88	125	125	31	1,0	98	250
18	90	93	135	135	35	1,1	120	300
20	100	103	150	150	38	1,1	122	320
22	110	113	160	160	38	1,1	129	360
24	120	123	170	170	39	1,1	140	400
26	130	133	187	190	45	1,5	183	540
28	140	143	197	200	46	1,5	190	570
30	150	153	212	215	50	1,5	236	735
32	160	163	222	225	51	1,5	245	780
34	170	173	237	240	55	1,5	285	930
36	180	183	245	250	56	1,5	290	1000
38	190	194	265	270	62	2,0	335	1160
40	200	204	275	280	62	2,0	340	1220

Табела П42-12а.


Колутни куглични
једнореди лежај
Ознака 511
Ред мера 11

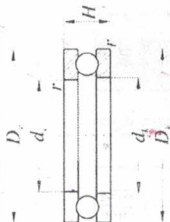

ozn. prov.	dv mm	dk mm	Dv mm	Dk mm	H mm	r mm	C kN	C0 kN
00	10	11	24	24	9	0,3	10	14
01	12	13	26	26	9	0,3	10,4	15,3
02	15	16	28	28	9	0,3	10,4	15,3
03	17	18	30	30	9	0,3	9,65	15,3
04	20	21	35	35	10	0,3	12,7	20,8
05	25	26	42	42	11	0,6	15,6	29
06	30	32	47	47	11	0,6	16,6	33,5
07	35	37	52	52	12	0,6	17,6	37,5
08	40	42	60	60	13	0,6	23,2	50
09	45	47	65	65	14	0,6	24,5	57
10	50	52	70	70	14	0,6	25,5	63
11	55	57	78	78	16	0,6	31	78
12	60	62	85	85	17	1,0	36,5	93
13	65	67	90	90	18	1,0	37,5	98
14	70	72	95	95	18	1,0	44	104
15	75	77	100	100	19	1,0	44	137
16	80	82	105	105	19	1,0	45	140
17	85	87	110	110	19	1,0	45,5	150
18	90	92	120	120	22	1,0	60	190
20	100	102	135	135	25	1,0	85	270
22	110	112	145	145	25	1,0	86,5	290
24	120	122	155	155	25	1,0	90	310
26	130	132	170	170	30	1,0	112	390
28	140	142	178	180	31	1,0	112	400
30	150	152	188	190	31	1,0	110	400
32	160	162	198	200	31	1,0	112	430
34	170	172	213	215	34	1,1	132	500
36	180	183	222	225	34	1,1	134	530
38	190	193	237	240	37	1,1	170	655
40	200	203	245	250	37	1,1	170	655

Табела П42-12г.


Колутни куглични
једнореди лежај
Ознака 514
Ред мера 14

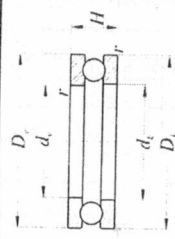

озн. пров.	d_v mm	d_k mm	D_v mm	D_k mm	H mm	r mm	C kN	C_0 kN
05	25	27	60	60	124	1.0	56	90
06	30	32	70	70	28	1.0	72	125
07	35	37	80	80	32	1.1	86.5	156
08	40	42	90	90	36	1.1	112	204
09	45	47	100	100	39	1.1	129	245
10	50	52	110	110	43	1.5	156	310
11	55	57	120	120	48	1.5	180	360
12	60	62	130	130	51	1.5	200	400
13	65	68	140	140	56	2.0	216	450
14	70	73	150	150	60	2.0	236	500
15	75	78	160	160	65	2.0	250	560
16	80	83	170	170	68	2.1	270	620
17	85	88	177	180	72	2.1	290	680
18	90	93	187	190	77	2.1	305	750
20	100	103	205	210	85	3.0	365	965
22	110	113	225	230	95	3.0	415	1140
24	120	123	245	250	102	4.0	425	1220
26	130	134	265	270	110	4.0	520	1600
28	140	144	275	280	112	4.0	510	1600
30	150	154	295	300	120	4.0	560	1800

Табела П42-12в.

Колутни куглични
једнореди лежај
Ознака 513
Ред мера 13

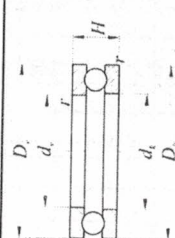

озн. пров.	d_v mm	d_k mm	D_v mm	D_k mm	H mm	r mm	C kN	C_0 kN
05	25	27	52	52	18	1.0	34.5	55
06	30	32	60	60	21	1.0	38	65.5
07	35	37	68	68	24	1.0	50	88
08	40	42	78	78	26	1.0	61	112
09	45	47	85	85	28	1.0	75	140
10	50	52	95	95	31	1.1	88	173
11	55	57	105	105	35	1.1	102	208
12	60	62	110	110	35	1.1	106	220
13	65	67	115	115	36	1.1	137	300
14	70	72	125	125	40	1.1	163	360
15	75	77	135	135	44	1.5	190	425
16	80	82	140	140	44	1.5	196	465
17	85	88	150	150	49	1.5	232	560
18	90	93	155	155	50	1.5	275	720
20	100	103	170	170	55	2.0	325	915
22	110	113	187	190	63	2.1	360	1060
24	120	123	205	210	70	2.1	405	1220
26	130	134	220	225	75	2.1	455	1500
28	140	144	235	240	80	2.1	520	1830
30	150	154	245	250	80	2.1	520	1830
32	160	164	265	270	87	3.0	620	2400
34	170	174	275	280	87	3.0	620	2400
36	180	184	295	300	95	3.0	620	2400
38	190	195	315	320	105	4.0	620	2400
40	200	205	335	340	110	4.0	620	2400